

## Network Master Pro/Flex Release Notes

### Latest Installer File Name

3.03.MT1000A\_SW

3.03.MT1100A\_SW

MX100001A-Setup-3.03-xxxxx.exe

### Installation Procedure

1. When using battery, make sure that there is 40% (or more) power in the battery of the instrument.
2. Remove the AC adapter or cable and power off the MT1000A/MT1100A.
3. Copy installer onto an empty USB memory stick.
4. Insert USB memory stick into MT1000A/MT1100A.
5. Boot MT1000A/MT1100A to start installer.


The instrument will detect the USB stick, and start installing the software. After the installation has finished the instrument will reboot and start with the new software.

6. Remove USB stick after installation is complete

You can check the installed version at **System Information** screen.

### Installation Procedure via network.

1. When using battery, make sure that there is 40% (or more) power in the battery of the instrument.
2. Install the Control Software(MX100001A) on your PC. (Please refer “3.5.1 Installation of Control Software” on operation manual.)
3. Configure the Ethernet communication between the Control Software(MX100001A) and MT1000A/MT1100A. (Please refer “3.5.2 Connection and Setup” on operation manual.)
4. Select the update tab on Control Software to show the upgrading box.

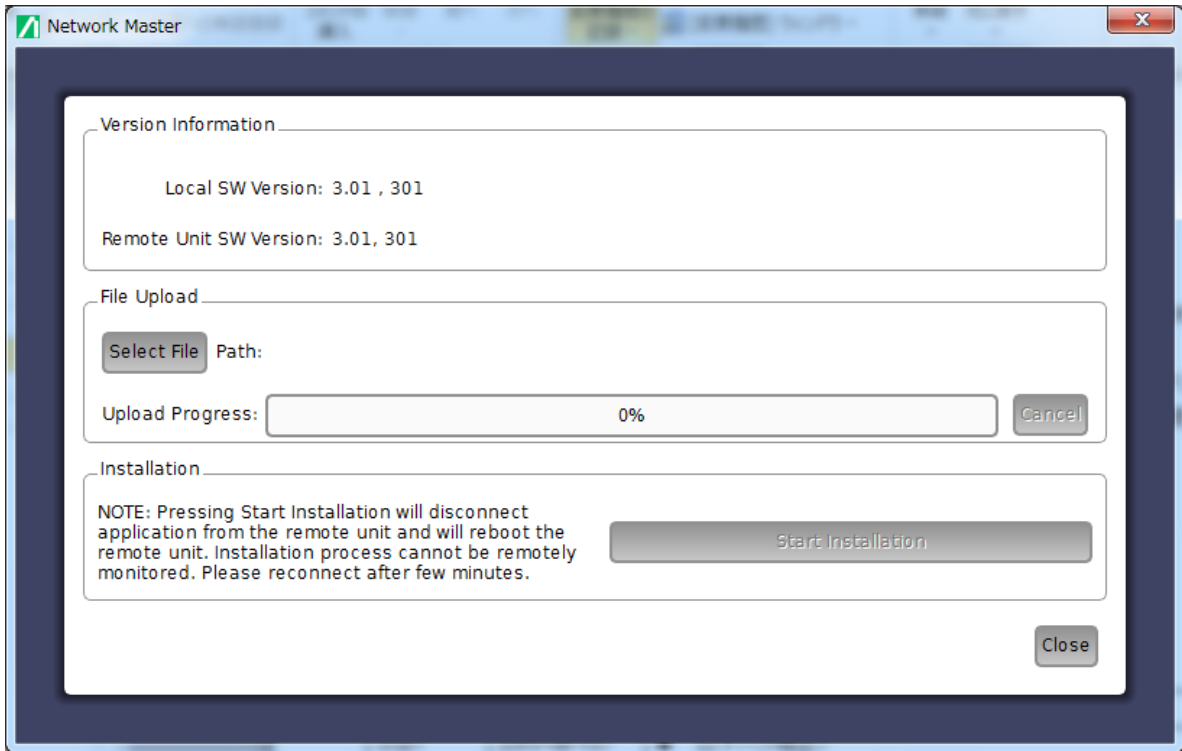

5. Touch Select File to launch the dialog box.
6. Select the software file. Progress bar shows Upload Progress. Touching Cancel aborts the file uploading.
7. After file uploading finishes, touch Start Installation.  
Touching Start Installation will reboot the Network Master. Installation process cannot be remotely monitored. Please reconnect after few minutes.

## Revision History

Version	Date	Description
3.03	2015-10-02	<ul style="list-style-type: none"> <li>● Key Added Features               <ul style="list-style-type: none"> <li>➤ [Remote] Added Remote Commands and Application Parts.</li> <li>➤ [ETH] Added Function for Custom Editing of Ethernet Header.</li> <li>➤ [ETH] Added Function for Validating PCS at 10 GbE.</li> <li>➤ [ETH] Added Function for continues Stream address Creation.</li> <li>➤ [OTN] Added Null to Client Signals for OTN Mappings.</li> <li>➤ [ETH] Enhanced RFC2544 GUI for Easier Access and Better Overview.</li> <li>➤ [ETH] Enhanced RFC2544/Y.1564 Reporting Providing More Information.</li> <li>➤ [ETH] Renamed 'CFI' bit in VLAG tag to 'DEI' according to 2015 version of IEEE802.1Q.</li> </ul> </li> </ul>

Version	Date	Description
		<ul style="list-style-type: none"> <li>➤ [Framework] Improved Report Layout: Better Look and Distinct Header Styles.</li> <li>➤ [Framework] Added Function for Filtering Results Display at Report Output.</li> <li>● Fixed Bugs <ul style="list-style-type: none"> <li>➤ [Framework] Fixed problem with removing USB storage while viewing PDF or XML file stored on device (7359)</li> <li>➤ [Framework] Fixed problem with garbage characters sometimes occurring in Japanese PDF reports created using MX100001A Control Software and read under Windows 7 64-bit OS environment (7028)</li> <li>➤ [ETH] Fixed problem with IEEE 1588 Log sometimes repeating old events. (7390)</li> <li>➤ [ETH] Fixed problem with PTP clock system when running high rates of Sync/Announce/Delay Request packets for IEEE 1588 protocol data (7389)</li> <li>➤ [ETH] Fixed problem with 40/100G Reflector application causing statistics engine to drop frames when swapping of IP/MAC disabled (7376)</li> <li>➤ [ETH] Fixed problem initiating OAM 802.ah Remote Loopback on Accedian NIDs (7365)</li> <li>➤ [ETH] Fixed problem with Disruption errors sometimes reported in Event Log while running RFC 2544 Latency Test (7361)</li> <li>➤ [ETH] Fixed problem with Pass-Through application running GbE electrical causing dropped frames when changing clock advertisement (master/slave) configuration (7284)</li> <li>➤ [ETH] Fixed problem with storing RFC 2544 result files when test includes more than 148 steps (7136)</li> <li>➤ [ETH] Fixed problem with the Unicast/Multicast Tx frame counters on "Ethernet - Transmit" statistics page not updating when U/L bit of destination MAC address set (7108)</li> <li>➤ [ETH] When using GPS as Master Clock reference for IEEE1588v2, fixed problem with current Wall Clock differing from displayed UTC time (6996)</li> <li>➤ [ETH] For RFC 2544 and SAT (Y.1564) applications running end-to-end network test, fixed problem with "Abort" window remaining on slave after test finishes (6957)</li> </ul> </li> </ul>

Version	Date	Description
		<ul style="list-style-type: none"> <li>➤ [ETH] For SAT Y.1564 and Mon/Gen. applications, fixed problem with automatically stored settings files potentially causing applications to fail when re-launched (6956)(7529)</li> <li>➤ [ETH] Solved problem with disabling SyncE sometimes leaving pending SSF Alarm History and Event Log entry (6912)</li> <li>➤ [ETH] Fixed problem with local port losing link when inserting "No Link" alarm, although incoming signal OK (6877)</li> <li>➤ [ETH] Corrected table headings in RFC 2544 Latency report when "Mesaure jitter by means of Latency test" enabled (7538)</li> <li>➤ [OTN] Fixed problem with not showing correct values for GMP Justification Max/Min Cm. (7482)</li> <li>➤ [OTN] Fixed problem when using multistage mapping on OTN where "false" LOFLOM alarms sometimes reported on lower-order ODUs (7006)</li> <li>➤ [PDH] Fixed problem on E1 interface when Distant and No CAS MFAS alarms sometimes also insert pattern errors (7019)</li> <li>➤ [SDH/SONET] Fixed problem with duplication of APS detailed results when switching between ports (7382)</li> <li>➤ [Remote][NoFrame] Fixed problem setting Frequency Offset via SCPI: NFRame:PORT&lt;Pt&gt;:STIMuli:TX:FOFFset &lt;offset&gt; (7465)</li> <li>➤ [Remote] Fixed problem with instrument potentially freezing/restarting when SCPI session closed immediately after starting or terminating application server (7012) (7347)</li> <li>➤ [Remote] Fixed problem copying multiple files simultaneously to PC from MT1000A/MT1100A using MX100001A Remote Control Software (6986)</li> <li>➤ [Remote][CPRI] Fixed problem using <ul style="list-style-type: none"> <li>✧ MEASurement:SETup:EVALuation:RX:INTerface?</li> </ul> command in CPRI BERT application (6992)" </li> <li>➤ [Remote][CPRI] When running CPRI Pass-Through application, fixed problem preventing use of SCPI commands for setting evaluation of measurement results (7042) <ul style="list-style-type: none"> <li>✧ MEASurement:SETup:EVALuation:RX&lt;Pt&gt;[:ENABLE]</li> <li>✧ MEASurement:SETup:EVALuation:RX&lt;Pt&gt;:INTerface</li> <li>✧ MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;:ITEM</li> <li>✧ MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;:ITEM:ALARm</li> </ul> </li> </ul>

Version	Date	Description
		<ul style="list-style-type: none"> <li>✧ MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;:ITEM:ERRor</li> <li>✧ MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;:TYPE</li> <li>✧ MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;:CNT:FAIL</li> <li>✧ MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;:RATIo:PASS</li> <li>✧ MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;:RATIo:FAIL</li> <li>✧ MEASurement:SETup:EVALuation:TMBPs:RX&lt;Pt&gt;:ITEM"</li> <li>➤ [Remote][ETH] Fixed problem with SCPI command for setting stimuli alarm state (ETHernet:POER&lt;Pt&gt;:STIMuli:ALARm) unnecessarily resetting electrical PHY, causing link loss for several seconds (6993)</li> <li>➤ [Remote][OTN] When configured via SCPI remote control, fixed problem with Ethernet client not obtaining link when mapped to OTU3/4 using GFP-T (6955)</li> <li>➤ [OTN] Fixed problem using SCPI MAX and DEF parameter values for setting Error Bits for GMP JC1/JC2 Error Items (6775) <ul style="list-style-type: none"> <li>✧ OTN:STIM:TX1:GMP:AEIN:EBIT MAX</li> <li>✧ OTN:STIM:TX1:GMP:AEIN:EBIT DEF</li> </ul> </li> </ul>
3.02	2015-07-29	<ul style="list-style-type: none"> <li>● Fixed Bugs <ul style="list-style-type: none"> <li>➤ [Framework] Fixed Problem of Incorrectly Loading Configuration File made Using MT1000A/MT1100A with Different Options.(7110,7053,7038,7000)</li> <li>➤ [Framework] Using Remote GUI Software (MX100001A), Fixed Problem Causing Inability to Start Editor and Viewer.(6990)</li> <li>➤ [ETH] Removed “Communication Port” for RFC 6349 End-to-End Test.(7172)</li> <li>➤ [ETH] Fixed Problem of Failing to Reflect “Expected preamble length” Value at Loading Configuration File for Ethernet Pass Through Application.(7156)</li> <li>➤ [ETH] Using Ethernet BERT Application, Fixed Problem of Incorrect File Save/Read when Stream Setting for Port 2 and Later Ports set to Unframed.(7041)</li> <li>➤ [ETH] Using Ethernet application, fixed problem causing inability to reboot main frame when sending following query commands and quitting application.(7022) <ul style="list-style-type: none"> <li>ETHernet:PORT&lt;Pt&gt;:OAM:DISCcovery:CATalog?</li> </ul> </li> <li>➤ [ETH] Fixed Problem of Disappearing Latency Results when</li> </ul> </li> </ul>

Version	Date	Description
		<p>Saving and Loading Latency/Burst Result using RFC 2544 Application.(7010)</p> <ul style="list-style-type: none"> <li>➤ [ETH] Using Ethernet BERT Application, Fixed Problem Causing Frame Loss when Reading V2.04 Settings File.(7004)</li> <li>➤ [ETH] After executing Ethernet Ping function, fixed problem causing reboot when executing other Ethernet application.(6999)</li> <li>➤ [ETH] Using Ethernet Application, Fixed Problem Causing Screen Freeze when Sending/Receiving OAM 802.1ag/VLAN CCM.(6980)</li> <li>➤ [ETH] Added following query parameters to SCPI commands.(6975) <ul style="list-style-type: none"> <li>ETHERnet:PORT&lt;Pt&gt;:IFETch?</li> <li>TDL: Stream 1 Throughput Data Layer (bps). Response: &lt;Min&gt;,&lt;Max&gt;,&lt;Avg&gt;</li> <li>TNL: Stream 1 Throughput Network Layer (bps). Response: &lt;Min&gt;,&lt;Max&gt;,&lt;Avg&gt;</li> <li>TLL: Stream 1 Throughput Link Layer (bps). Response: &lt;Min&gt;,&lt;Max&gt;,&lt;Avg&gt;</li> <li>TPPL: Stream 1 Throughput Physical Layer without Preamble (bps). Response: &lt;Min&gt;,&lt;Max&gt;,&lt;Avg&gt;</li> <li>TPL: Stream 1 Throughput Physical Layer (bps). Response: &lt;Min&gt;,&lt;Max&gt;,&lt;Avg&gt;</li> <li>TUL: Stream 1 Throughput Utilization Layer (bps). Response: &lt;Min&gt;,&lt;Max&gt;,&lt;Avg&gt;</li> </ul> </li> <li>➤ [ETH] Using Ethernet Application, at ARP Reply Sending, Fixed Rare Problem Causing Sending of Excess Stream Data in 1 Frame.(6970)</li> <li>➤ [ETH] Using Ethernet Application, Fixed Problem Sometimes Blocked Correct traffic with "Include addresses in frame filter on receiver" Settings at Rx Operation.(6964)</li> <li>➤ [OTN] Fixed Problem of Wrongly Configuring FC800 at Loading of FC400 Configuration File for FC BERT over OTN.(7169)</li> <li>➤ [OTN] Fixed Boot Failure Problem of FC BERT over OTN Application.(7166)</li> <li>➤ [OTN] Fixed problem causing no response when sending OTN:RX&lt;Pt&gt;:IFET ch? S0MSIM SCPI command.(7066)</li> </ul>

Version	Date	Description
		<ul style="list-style-type: none"> <li>➤ [OTN] Using OTN Application, Fixed Problem of Wrongly Displaying MSIM Results Without Masking even at Higher-Level Alarm.(7066)</li> <li>➤ [OTN] Using OTN application, fixed problem of incorrectly reading Performance measurement results using SCPI command when reading V2.02 or earlier results file.(7066)</li> <li>➤ [OTN] Fixed Problem Causing Higher-Level Summary LEDs to Light when cHEC and tHEC Errors Detected at GFP-F/T Mapping of OTN Application.(6972)</li> <li>➤ [OTN] Fixed Problem of Failing to Count Justification when LOFLOM Detected using OTN Application.(6962)</li> <li>➤ [SDHPDH] Changed mistakes in SCPI command parameter names.(7140) <ul style="list-style-type: none"> <li>T1:RX&lt;Pt&gt;:IFETch? (NFRame) -&gt; (OOF)</li> <li>T1:APS:RX&lt;Pt&gt;:EVENT NFR -&gt; OOF</li> <li>T1:STATus:RX&lt;Pt&gt;:ALARm? Loss Of Frame -&gt; OOF</li> <li>TMBPs:APS:RX&lt;Pt&gt;:EVENT NFR -&gt; NFRame</li> <li>- similar GUI value "LOF"-&gt; "No frame"</li> </ul> </li> <li>➤ [SDHPDH] Using SDH/PDH application, fixed problem of inability to reboot main frame when sending following query commands and quitting application.(7031) <ul style="list-style-type: none"> <li>E3:RX1:IFET? (PBBE)</li> </ul> </li> <li>➤ [SDHPDH] Added E1 Balanced connector pin assignments to manual.(6958)</li> <li>➤ [SDHPDH] Fix problem causing reboot when loading settings file with set PDH rate at MU110011A module.(6915)</li> <li>➤ problem preventing use of threshold parameters set by following SCPI commands at evaluation of actual measurement results.(7042) <ul style="list-style-type: none"> <li>MEASurement:SETup:EVALuation:RX&lt;Pt&gt;:[:ENABLE]</li> <li>MEASurement:SETup:EVALuation:RX&lt;Pt&gt;[:INTERFACE]</li> <li>MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;[:ITEM]</li> <li>MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;[:ITEM]:ALARm</li> <li>MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;[:ITEM]:ERRor</li> <li>MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;[:TYPE]</li> <li>MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;[:CNT]:FAIL</li> <li>MEASurement:SETup:EVALuation:CPRI:PORT&lt;Pt&gt;[:RATIo]:PASS</li> </ul> </li> </ul>

Version	Date	Description
		<p>MEASurement:SETup:EVALuation:CPRI:PORT\$&lt;\$Pt\$&gt;\$.RATio:FAIL  MEASurement:SETup:EVALuation:TMBPs:RX\$&lt;\$Pt\$&gt;\$.ITEM</p> <ul style="list-style-type: none"> <li>➤ [CPRI] Fixed Problem of Incorrect RTD Result Display at Each Testing Interval of CPRI BERT Application.(6875)</li> <li>➤ [FC] Fixed Problem of Missing CRC Error in Errors/Alarms List of Fibre Channel BERT Application.(6862)</li> </ul>
3.01	2015-06-05	<ul style="list-style-type: none"> <li>● Key Added Features <ul style="list-style-type: none"> <li>➤ [All] Added Error/Alarm indication summary.(6888)</li> <li>➤ [All] Added Performance Verification date in test report.(6890)</li> <li>➤ [All] Added Spanish Language support.(6891)</li> <li>➤ [Framework] Added the functionality of Storage formatting.(6895)</li> <li>➤ [RemoteGUI] Added "Settings Editor" and "Result Viewer" on MX100001A (Windows application).(6894, 6942)</li> <li>➤ [ETH] Added the functionality of "Answering ARP/PING request" and reflector MAC/IP address settings on Reflector application. (6897)</li> <li>➤ [OTN] Added the client signal frequency result.(6887, 6868)</li> <li>➤ [OTN] Added "Pattern Bit Error Trigger" and "LOS Trigger" on APS application. (6867)</li> <li>➤ [ETH] Added "LOS" as a Ethernet Service Disruption test type for optical interfaces</li> </ul> </li> <li>● Fixed Bugs <ul style="list-style-type: none"> <li>➤ [Framework] Fixed battery display information to show correctly on MU110001A. (6902)</li> <li>➤ [RemoteGUI] Fixed the problem regarding sorting files on windows application.(6878)</li> <li>➤ [ETH] Fixed the problem regarding SCPI command for stream Line load. (6866)</li> <li>➤ [ETH] Fixed the problem regarding multi stream measurement on Mon/Gen application. (6940)</li> <li>➤ [ETH] Fixed the problem regarding SDT(Service Disruption Time) result. (6857)</li> <li>➤ [ETH] Fixed the problem regarding long term measurement on PING application. (6834)</li> <li>➤ [ETH] Fixed the problem regarding the variable field of VLAN</li> </ul> </li> </ul>



Version	Date	Description
		<p>ID. (6860)</p> <ul style="list-style-type: none"> <li>➤ [ETH] Fixed the problem regarding Remote Fault on Electrical Interface.(6859)</li> <li>➤ [ETH] Fixed the problem regarding the maximum rate(CIR/EIR) on 40/100G Y.1564 application. (6855, 4246)</li> <li>➤ [FC] Fixed the problem regarding SDT(Service Disruption Time) result. (6863)</li> <li>➤ [FC] Fixed the problem regarding “Frame Loss Seconds” result. (6864)</li> <li>➤ [OTN] Fixed application crash issue when starting a measurement with threshold enabled. (6939)</li> <li>➤ [OTN] Improved regarding frequency offset.(6887)</li> </ul>
3.00	2015-05-25	<ul style="list-style-type: none"> <li>● Added CPRI applications.(6465)</li> <li>● Added following functions to Ethernet applications: <ul style="list-style-type: none"> <li>➤ Added RFC6349 application.(6366)</li> <li>➤ Added Layer 2 frame format support on Y.1564 application.(6398)</li> <li>➤ Added automatic service name on Y.1564 application.(6360)</li> <li>➤ Added “Include addresses in frame filter on receiver ON/OFF” on RFC2544/Y.1564/MonGen applications.(6557)</li> </ul> </li> <li>● Added following functions to OTN applications: <ul style="list-style-type: none"> <li>➤ Added 3stage mapping on OTU3/4.(6369)</li> <li>➤ Added BMP mapping of SDH client.(6372)</li> <li>➤ Added FTFL alarm insertion/detection.(6373)</li> <li>➤ Improved the setting order of OTN Client.(6374)</li> <li>➤ Supported GFP-F Client signal up to 100G.(6369)</li> <li>➤ Added Error/Alarm statistics on APS application.(6399)</li> </ul> </li> <li>● Added following functions to SDH applications: <ul style="list-style-type: none"> <li>➤ Added Pattern Error Trigger on APS application.(6419)</li> <li>➤ Added Error/Alarm statistics on APS application.(6399)</li> </ul> </li> <li>● Added following functions to FC applications: <ul style="list-style-type: none"> <li>➤ Added Frequency offset Insertion/Monitor.(6405)</li> <li>➤ Added Reflector application.</li> </ul> </li> <li>● Added following common functions: <ul style="list-style-type: none"> <li>➤ Added GUI remote functionality from PC.(6342,6341)</li> <li>➤ Added Event Log functionality.(6400)</li> <li>➤ Added VIP application on Utility.(6367)</li> </ul> </li> </ul>

Version	Date	Description
		<ul style="list-style-type: none"> <li>➤ Added MDIO analysis functionality for CFP module.(6351)</li> <li>➤ Added electrical extender module support.(6483)</li> <li>➤ Added external 10MHz clock support.(6464)</li> <li>➤ Added Emphasis and Equalizer functionality for CFP/CFP2.(6352)</li> <li>➤ Added Swedish keyboard input support.(6345)</li> <li>➤ Added CSV format report support.(6340)</li> <li>➤ Improved Utility Icon visualization.(6365,6362,6361)</li>   <li>➤ Fixed Bugs [All] Fixed the problem that CFP2 interface may not work correctly when configuring the timing source, "Received".(6667)</li> <li>➤ [All] Fixed the problem that MT1100 which mounts MU110010A sometimes shutdown when launching with battery.(6880)</li> <li>➤ [SCPI] Fixed the problem of Measurement Stop just after Measurement Start.(6726)</li> <li>➤ [SCPI] Improved the stability of long term SCPI running.(6707)</li> <li>➤ [ETH] Fixed the problem that MPLS-TP result does not count up when MPLS-TP OAM frame received.(6762)</li> <li>➤ [ETH] Fixed the problem regarding E2E communication between MT1000/MT1100 and CMA3K on RFC2544 application.(6735)</li> <li>➤ [ETH] Fixed the problem regarding selection of throughput type on RFC2544 application.(6658)</li> <li>➤ [ETH] Improved the stability of long term running on RFC2544 application.(6656, 6644)</li> <li>➤ [ETH] Fixed the problem that SDT result resets when LOS detected.(6570)</li> <li>➤ [ETH] Fixed the problem regarding PCS alarm LED.(5892)</li> <li>➤ [OTN] Fixed the problem regarding the mapping for 10GbE into ODU2e, mapping procedure is AMP (Asynchronous CBR Mapping). (6372)</li> <li>➤ [SDH] Fixed the problem regarding Performance measurement.(5419)</li> <li>➤ [FC] Fixed the problem regarding SDT measurement.(6531)</li> <li>➤ [FC] Fixed the problem that undersize frame sometimes counts.(6254)</li> </ul>

Version	Date	Description
		<ul style="list-style-type: none"> <li>➤ [NoFrame] Fixed the problem regarding the BERT measurement result on NoFrame application.(6733)</li> <li>➤ [ETH] Default setting of throughput calculation layer is changed on RFC 2544</li> <li>➤ [ETH] Fixed the process of handling larger test results than the available storage on RFC 2544</li> <li>➤ [ETH] RFC 2544 "Average Throughput" test calculation fixed by only calculating during a stable data stream</li> </ul>
2.05	2015-03-25	<ul style="list-style-type: none"> <li>● Bug fixes and Improvements <ul style="list-style-type: none"> <li>➤ [OTN] Fixed the problem regarding the error on OUT3-40GbE mapping.(6454)</li> <li>➤ [All] Fixed the problem on MU110001A without battery operation. (Bug only for ver. 2.04) (6411)</li> <li>➤ [All] Fixed the problem that application crashed after long term running.(6455, 6552)</li> <li>➤ [All] Fixed the problem regarding the network configure on the Ethernet Service Interface.(6461)</li> </ul> </li> </ul>
2.04	2015-01-22	<ul style="list-style-type: none"> <li>● Enhancements <ul style="list-style-type: none"> <li>➤ [SCPI] Added the launching GUI command and the functionality of switching control between the GUI and Remote.(6355)</li> <li>➤ [PDH] Added the PRBS31 test pattern on E3.(6064)</li> </ul> </li> <li>● Bug fixes and Improvements <ul style="list-style-type: none"> <li>➤ [OTN] Fixed the problem regarding through mode.(6386)</li> <li>➤ [OTN] Fixed the problem regarding the Performance measurement. (6264)</li> <li>➤ [OTN] Fixed the problem regarding the OTN payload type setting/detection for ODU4-ODU2e-10GE mapping. (6401)</li> <li>➤ [ETH] Fixed the problem regarding transmitting stream on 40/100G.(6281)</li> <li>➤ [ALL] Improved the stability when measuring.(6376,6229)</li> </ul> </li> </ul>
2.03	2014-12-18	<ul style="list-style-type: none"> <li>● Bug fixes and improvements <ul style="list-style-type: none"> <li>➤ [OTN] Added some Errors (LLM-OTL, MFAS-OTL). (6262)</li> <li>➤ [OTN] Added some Error Trigger Type on APS measurement. (6261)</li> <li>➤ [OTN] Changed the name of some Errors. (OTL, LOA, LOBL, LOAML) (6262)</li> </ul> </li> </ul>

Version	Date	Description
		<ul style="list-style-type: none"> <li>➤ [SDH] Improved the updating results on Pointer Movement measurement. (6265)</li> <li>➤ [ETH] Fixed the problem regarding the showing service number on Y1564 application. (6295)</li> <li>➤ [ETH] Fixed the problem of End to End measurement on Y.1564 application. (6291)</li> <li>➤ [ETH] Fixed the problem that HiBER is not detected. (6230)</li> <li>➤ [FW] Fixed the problem regarding the VNC connections. (6243)</li> <li>➤ [FW] Fixed the problem regarding the Battery information on MT1100.(6020)</li> <li>➤ [RFS] Supported ETSI R&amp;TTE EN300 328 V1.8.1. (6263)</li> <li>➤ [RFS] Improved the stability on all applications. (6318)</li> <li>➤ [RFS] Improved the stability of the Ethernet Service Interface. (6404)</li> </ul>
2.02	2014-11-11	<ul style="list-style-type: none"> <li>● Bug fixes and improvements <ul style="list-style-type: none"> <li>➤ [OTN] Fixed the bug which is on decode of ITU-T G709 PSI[0].(6231)</li> <li>➤ [ETH] Fixed the bug that NMX_ASSERT is sometimes occurred. (6232)</li> <li>➤ [FC] Fixed the bugs which are interoperability issue and some minor issues. (5088, 6253, 6254)</li> <li>➤ [Wireshrak] Fixed the bugs and improved the stability.(6166)</li> </ul> </li> </ul>
2.01	2014-10-23	<ul style="list-style-type: none"> <li>● Support for the following products: <ul style="list-style-type: none"> <li>➤ MT1100A Network Master Flex Mainframe</li> <li>➤ MU110010A 10G Multirate Module</li> <li>➤ MU110011A 100G Multirate Module</li> <li>➤ MU110012A 40/100G Module CFP2</li> </ul> </li> <li>● Added Fibre Channel applications</li> <li>● Added following functions to Ethernet applications: <ul style="list-style-type: none"> <li>➤ Support for WAN-PHY interface</li> <li>➤ Frame capture include Wireshark</li> <li>➤ Channel Statistics</li> </ul> </li> <li>● Added following functions to OTN applications: <ul style="list-style-type: none"> <li>➤ GFP-F mapping</li> <li>➤ FC client mapping</li> </ul> </li> <li>● Bug fixes and improvements</li> </ul>
1.00	2014-06-23	<ul style="list-style-type: none"> <li>● Initial release. Support for the following products:</li> </ul>

Version	Date	Description
		<ul style="list-style-type: none"> <li>➤ MT100A Network Master Pro Mainframe</li> <li>➤ MU100010A 10G Multirate Module</li> </ul>

## Known Problems

Version	Description
3.03	<ul style="list-style-type: none"> <li>● [CPRI] Pass-through delay for CPRI interface depends on previous port mode setting (6876)</li> <li>● [ETH] Service Disruption Time result exceeds 200 or 300 ms using CFP2 interface of Ethernet BERT application (6858)</li> <li>● [ETH] Using Ethernet RFC 2544 Application, Miscalculates Frame Loss Rate when ""Accumulated Repeated Steps"" On (6445)</li> <li>● [ETH] Burst count increases when transmitting Random frame sizes at 100% utilization (7114)</li> <li>● [ETH] In Ethernet Reflector application, when handling incoming special frames like ARP or PING requests, sometimes packets dropped in reflected traffic (6965)</li> <li>● [ETH] Disabling Extended Log option excludes basic PTP messages from IEEE 1588v2 Log (7421)</li> <li>● [ETH] Problem running 10G with specific combinations of line load and frame sizes, sometimes preventing insertion of sufficient block errors using error insertion function (7020)</li> <li>● [ETH] In Ethernet applications, sometimes Timing/Accumulated Difference in physical status window remains 0 after using Clear History function (6884)</li> <li>● [OTN] When OTN interface in Through Mode, invalid options to insert Low-order ODU errors/alarms are shown (6950)</li> <li>● [OTN] For client signals mapped over OTN, error/alarm insertion options displayed even when OTN interface in Through Mode and client signal error/alarm insertion disabled (6643)</li> <li>● [OTN] [ETH] Sometimes Ethernet traffic not correctly generated when Ethernet mapped into OTU3/4 using GFP-F (7519)</li> <li>● [SDH/PDH] Problem with APS application causing Port Status to report invalid Switch Error after test stopped (6982)</li> <li>● [Remote] Port resources are sometimes not released after terminating application server via SCPI (7369)</li> <li>● [Wireshark] sometimes instrument stalls/restarts when loading unsupported file formats in Wireshark application (7595)</li> </ul>

РАДАР - ОФИЦИАЛЬНЫЙ ПРЕДСТАВИТЕЛЬ ANRITSU



РОССИЯ, 198152, Санкт-Петербург  
Краснопутиловская ул., д.25  
Тел./факс +7 (812) 600-48-89  
Тел.: +7 (812) 375-32-44  
[www.radar1.ru](http://www.radar1.ru)  
[info@radar1.ru](mailto:info@radar1.ru)